



3. Install the Fernco flexible tap saddle. Tighten clamps to 60 inch-lbs. torque.



4. Attach the reinforcing bars to the saddle by sliding the clips under the saddle.



5. Bars must be centered and positioned overlapping the initial set of clamps.



6. Install the 2 clamps provided with the TSPK-46 around the host pipe near the saddle inlet, **INSIDE** the tap saddle bands.

NOTE: For TSW-4 ONLY Due to space restrictions, install the 2 clamps provided around the host pipe **OUTSIDE** the tap saddle bands.



7. Tighten clamps to 60 inch-lbs. torque. Test for leaks prior to backfilling.



United States PH: 810-503-9000 FX: 810-503-1015

www.fernco.com

Canada PH: 519-332-6711 FX: 519-332-8610